



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D119-646-041
Job Sheet 187205



Part No: D119-646-041

Job Qty: 1 ea

Part Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 11/28/18

Job Tracking No:

Due Date: 12/21/18

Created By: Jesse White


Type: Stock

Description:

Note: DWG IIN-D119-646 REV D, D3887-041 REV E SHEETS 1,2,5,7,8,10,11 IPP RevA: New issue DD verified by:EC IPP rev B 10.02.22 per PAR 09-043 EC verified by:DD IPP REV C 12.11.05 (DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per chg003 ECN13-534 DD verf:JLM IPP REV:E 17.05.19 as per dwg D3887 rev.e DD verf:JFS

Ship Via:

Bill of Materials

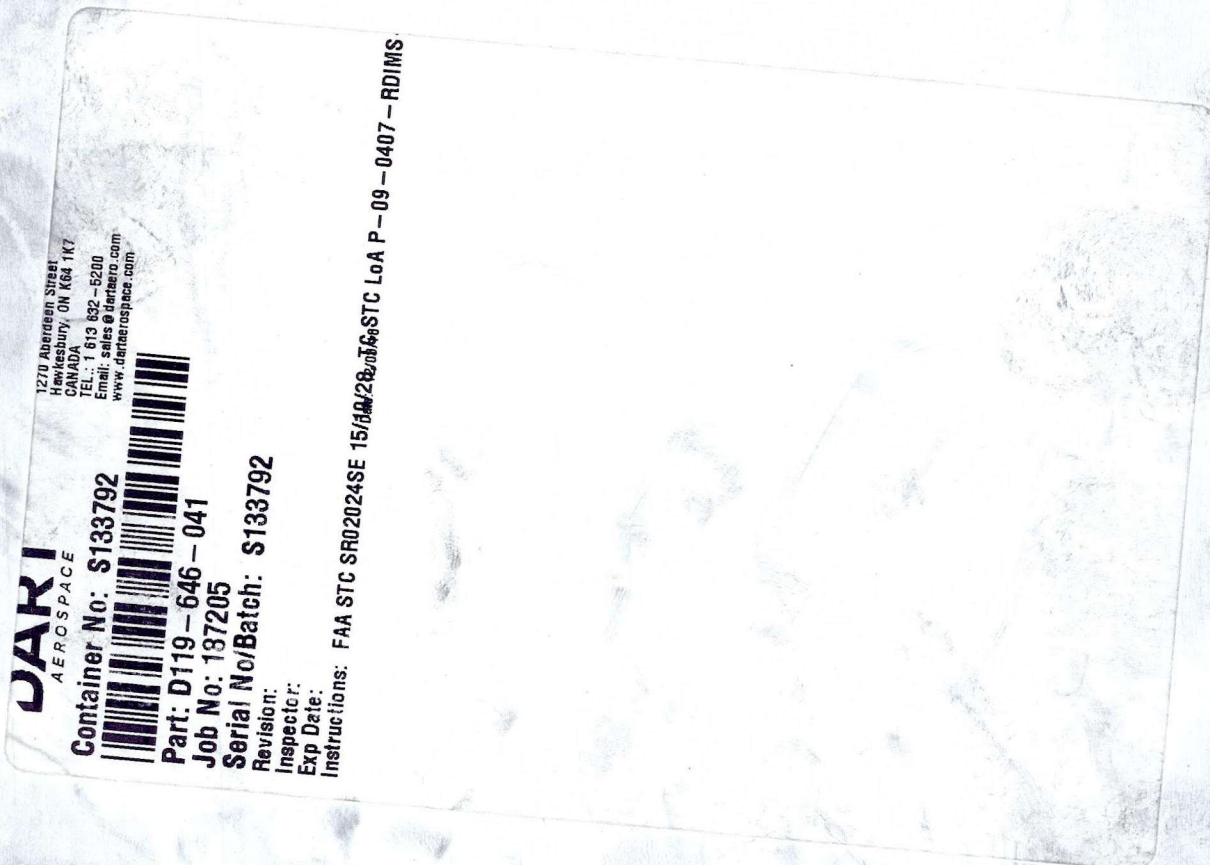

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐		
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)
Description Work Order Deviation		Disposition		
				Completed By
				Lead hand / Supervisor
				QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		
Other/Details:				

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		12/21/18	0.00	0.00	Start Up Skid tubes-1		
110	Skid tubes	1 pcs		12/21/18	0.00	0.25	Skid tubes-1		
120	HandFinish	1 pcs		12/21/18	0.00	0.83	HandFinish1		
121	QC	1 pcs		12/21/18	0.00	0.00	QC7-1		
122	QC	1 pcs		12/21/18	0.00	0.00	QC5		
130	Skid tubes	1 pcs		12/21/18	0.00	1.54	Skid tubes-1		
135	QC	1 pcs		12/21/18	0.00	0.00	QC5		
140	Skid tubes	1 pcs		12/21/18	0.00	1.47	Skid tubes-1		
150	QC	1 pcs		12/21/18	0.00	0.00	QC5		
160	Skid tubes	1 pcs		12/21/18	0.00	1.61	Skid tubes-1		
170	QC	1 pcs		12/21/18	0.00	0.00	QC5		
180	QC	1 pcs		12/21/18	0.00	0.00	QC10		
190	HandFinish	1 pcs		12/21/18	0.00	0.83	HandFinish2		
200	Powdercoat	1 pcs		12/21/18	0.00	0.22	Powdercoat1		
210	QC	1 pcs		12/21/18	0.00	0.00	QC3		
220	HandFinish	1 pcs		12/21/18	0.00	3.83	HandFinish4		
240	HandFinish	1 pcs		12/21/18	0.00	2.00	HandFinish4		
245	QC	1 pcs		12/21/18	0.00	0.00	QC5		
255	DC	1 pcs		12/21/18	0.00	0.00	DC		
260	Packaging	1 pcs		12/21/18	0.00	0.00	Packaging3-1		
270	QC21-FG	1 Ea		12/21/18	0.00	0.00	QC21		

Part Op 110 - 1- inspect Mat'L D2500-1-190 for damage 2-Cut tube to length as per dwg D3887 (154.8") 3- Ensure squareness of Descriptions: ends and scribe batch#

130 - 1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only. 2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes. 3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477 4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes*** 5- Deburr, blow out chips from inside of tube. 6- Bond web in place as per Dwg D3887 & QSI 015. A/R

140 - 1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog. D3887. ***Must use bending aid DT9544, ensure proper positioning*** 2- Cut FWD end of tube as per dwg D3887. ***Verify measurement*** 3- Buff out marks left from bending 4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208" 5- Open FWD saddle holes to finished size as per dwg D3887 6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size. (verify measurement) 7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size. 8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg 9- C'sink FWD cap hole as per detail "C" 10- Drill holes for wearpads using DT8931, open to 0.297". 11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr. 12- Deburr and blow out chips from inside of tube.

160 - NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091. 1- Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/R 2- Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole. 3- Counterbore 5/16" x 0.750" deep as per Dwg D3887. 4- Deburr & Scribe batch # on Aft end of tube.

170 - TEST FIT USING FIXTURE DT10091.

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - ***MASK AREA SHOWN ON SHEET 7, NOTE 9*** START TIME: 2:30 OVEN TEMPERATURE:

320° FINISH TIME: 3:00

220 - 1- Install inserts as per Dwg D3887.

240 - 1- Install inserts as per Dwg D3887. 2- Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 M128386 Sikaflex expire date: 14-03 3- assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: M138847 4- Inspect for foreign objects as per QSI 024 5- Install D2855-3 Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 M138886 Sikaflex expire date: 14-03 6- Install insert in D2855- Cap. Install cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 M128386 Sikaflex expire date: 14-02 7- Wing Walk as per dwg and QSI Batch: M138967

255 - Photocopy bluefile & type labels per PPP D119-646-041 CHG005

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐		
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____
Description Work Order Deviation		Disposition		Completed By
				Lead hand / Supervisor
				QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		
Other/Details: _____				

Job BOM

007572

Part / Item	Component Name	Quantity	Operation	Container
D2500-1-190	Ext'n -1' Beam Tube 4"	1 Ea (1 ea)	90-Start up Operation	5112963
D3885-1	Standard Web	1 Ea (1 ea)	130-Skidtubes	5083677
D2579	Crossbolt Spacer	2 Ea (2 ea)	140-Skidtubes	5051552
D2855-5	Cap	1 Ea (1 ea)	160-Skidtubes	5002078
D3681-1	Spacer	12 Ea (12 ea)	160-Skidtubes	5103210
D3903-1	Spacer	12 Ea (12 ea)	160-Skidtubes	5116459 x 9 512440 x 3
ALS4-1032-130	Rivnut	33 Ea (33 ea)	240-HandFinish	5007279
ALS4-1032-225	Rivnut	1 Ea (1 ea)	240-HandFinish	5058139
AN3C4A	Bolt	6 Ea (6 ea)	240-HandFinish	5123449
AN3C5A	Bolt	26 Ea (26 ea)	240-HandFinish	5075999
D2855-3	Cap	1 Ea (1 ea)	240-HandFinish	5126407
D3492-5	Plug 5124637 (x4)	24 Ea (24 ea)	240-HandFinish	5137514 (x4)
D3672-1	Washer, Phenolic	2 Ea (2 ea)	240-HandFinish	5164008
D3847-1	Wearpad 5133454 (x3)	5 Ea (5 ea)	240-HandFinish	5105242
D3847-11	Wearpad	1 Ea (1 ea)	240-HandFinish	5105230
MS24694-C52	Screw	2 Ea (2 ea)	240-HandFinish	5067268
NAS1149C0332R	Washer	32 Ea (32 ea)	240-HandFinish	5124666
NAS1611-005	O-Ring	24 Ea (24 ea)	240-HandFinish	5057657

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2500-1-190	1	58	0
130-Skidtubes	D3885-1	1	8	0
140-Skidtubes	D2579	2	199	0
160-Skidtubes	D2855-5	1	124	0
	D3681-1	12	134	0
	D3903-1	12	81	0
240-HandFinish	ALS4-1032-130	33	11,099	0
	ALS4-1032-225	1	1,319	0
	AN3C4A	6	1,690	0
	AN3C5A	26	1,502	0
	D2855-3	1	51	0
	D3492-5	24	119	0
	D3672-1	2	1,407	0
	D3847-1	5	24	0
	D3847-11	1	10	0
	MS24694-C52	2	120	0
	NAS1149C0332R	32	3,530	0
	NAS1611-005	24	303	0

Part Specifications

Specifications could not be found.

Plex 11/28/18 3:01 PM dart.white.jesse

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		FAULT CATEGORY Other/Details:			

8 7 6 5 4 3 2 1

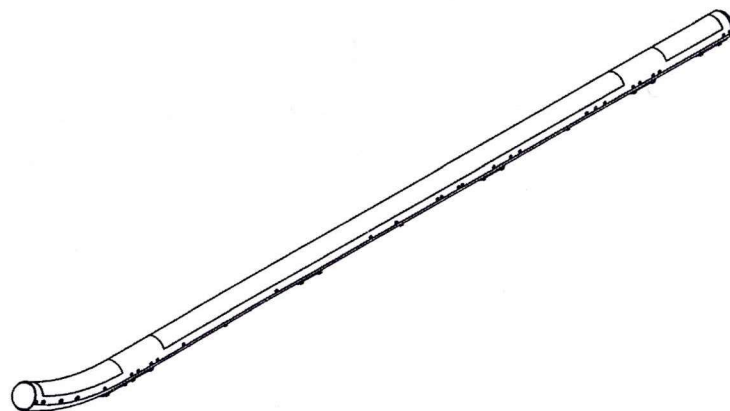

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD(SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

E	COMPLETE REDRAW, ADDED ASSY DETAILS -3, -051 & -053, SEE PREVIOUS REV. FOR DETAIL. POWDER COAT REMOVED FROM SADDLE AREA SEE DETAIL F. REF PART 15-421. ADDED STRUCTURAL PROVISIONS TO ALLOW FOR THE INSTALLATION OF THE D119-648-313/314 SKIDTUBE PROTECTOR KIT. REF PART 17-577. CHANGE QTY OF D2855-3, ADDED D2855-5 CAP ASSEMBLIES, ADDED INSTRUCTIONS TO LOCATE INSERT HOLE FOR D2855-5 CAP. REF PART 17-583	AJS / WK	17.02.03
D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SHT 1, P/L ZN C2-2, C3-2, C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24894-C32 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) 0.201 CSK Ø0.385 X 100 WAS Ø0.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A6-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD D78931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C2-3, C6-4, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE 4 (ZN B3-7)	RF	09.08.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 1 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMINGLED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
 2017-05-08
 17-519

8 7 6 5 4 3 2 1

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -041	P/N	DESCRIPTION
	X	D3887-041	STANDARD SKIDTUBE ASSY WITH WEARPAD
1	1	D2855-3	CAP ASSY
2	1	D2855-5	CAP ASSY
3	24	D3492-045	PLUG ASSY
4	2	D3672-1	PHENOLIC WASHER
5	5	D3847-1	WEARPAD
6	1	D3847-11	WEARPAD
7	1	D3887-051	SKIDTUBE ASSY
8	1	ALS4-1032-225	INSERT
9	26	AN3C5A	BOLT
10	6	AN3C4A	BOLT
11	2	MS24694-C52	SCREW, CSK 100°
12	32	NAS1149C0332R	WASHER

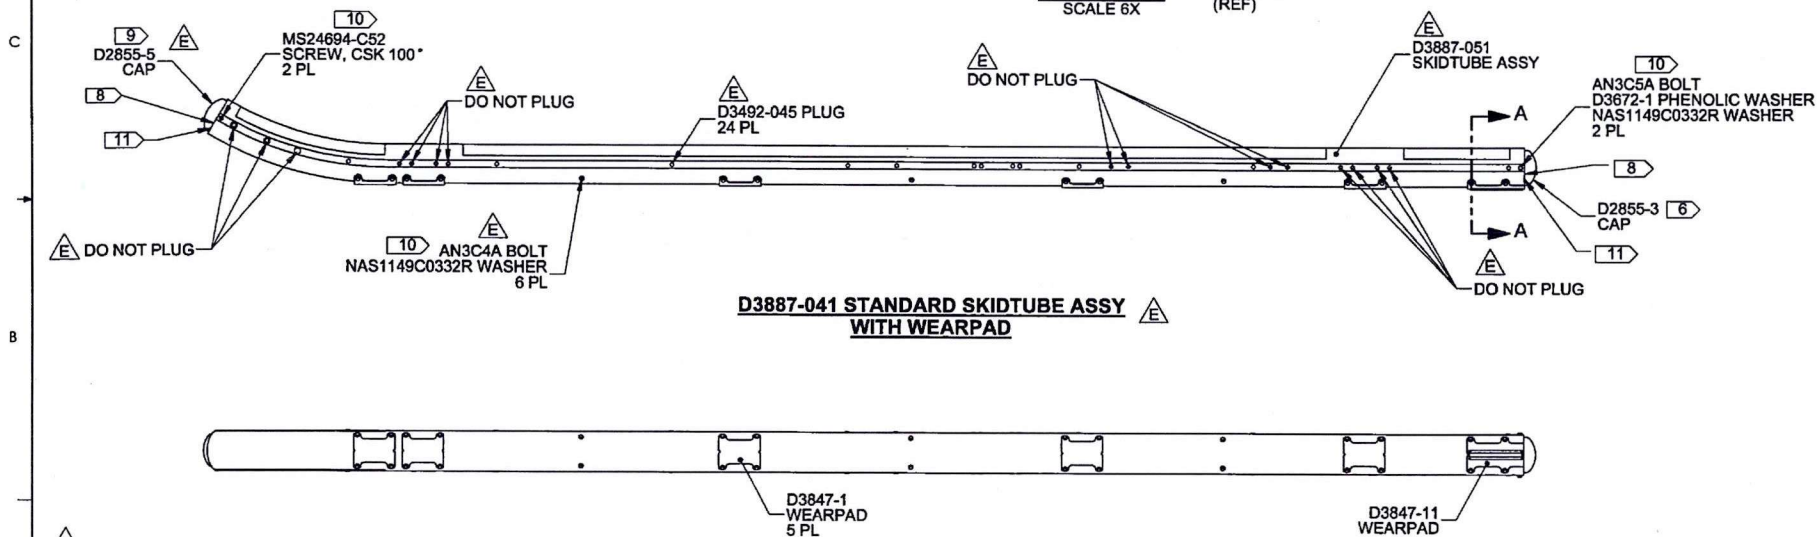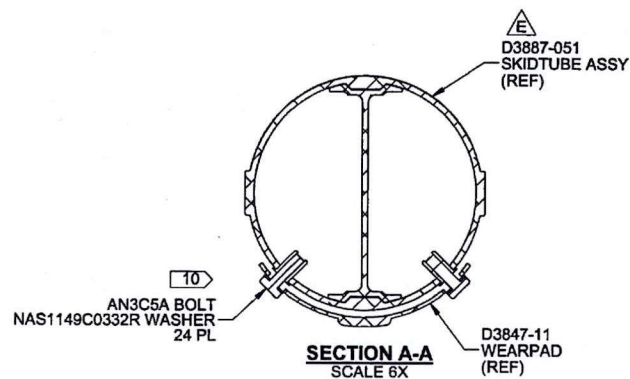

**D3887-041 STANDARD SKIDTUBE ASSY
WITH WEARPAD**



NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3887-041" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 32.0 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3887-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP. OPEN HOLE TO Ø0.297, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 2 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR COMMUNICATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -043	P/N	DESCRIPTION
	X	D3887-043	STANDARD SKIDTUBE ASSY WITH WEARPLATE
1	1	D2855-3	CAP ASSY
2	1	D2855-5	CAP ASSY
3	24	D3492-045	PLUG ASSY
4	2	D3672-1	PHENOLIC WASHER
5	1	D3847-043	FWD WEARPLATE ASSY
6	1	D3847-045	CENTER WEARPLATE ASSY
7	1	D3847-047	AFT WEARPLATE ASSY
8	5	D3847-1	WEARPAD
9	1	D3847-11	WEARPAD
10	1	D3887-051	SKIDTUBE ASSY
11	1	ALS4-1032-225	INSERT
12	32	AN3C5A	BOLT
13	2	MS24694-C52	SCREW, CSK 100"
14	32	NAS1149C0332R	WASHER

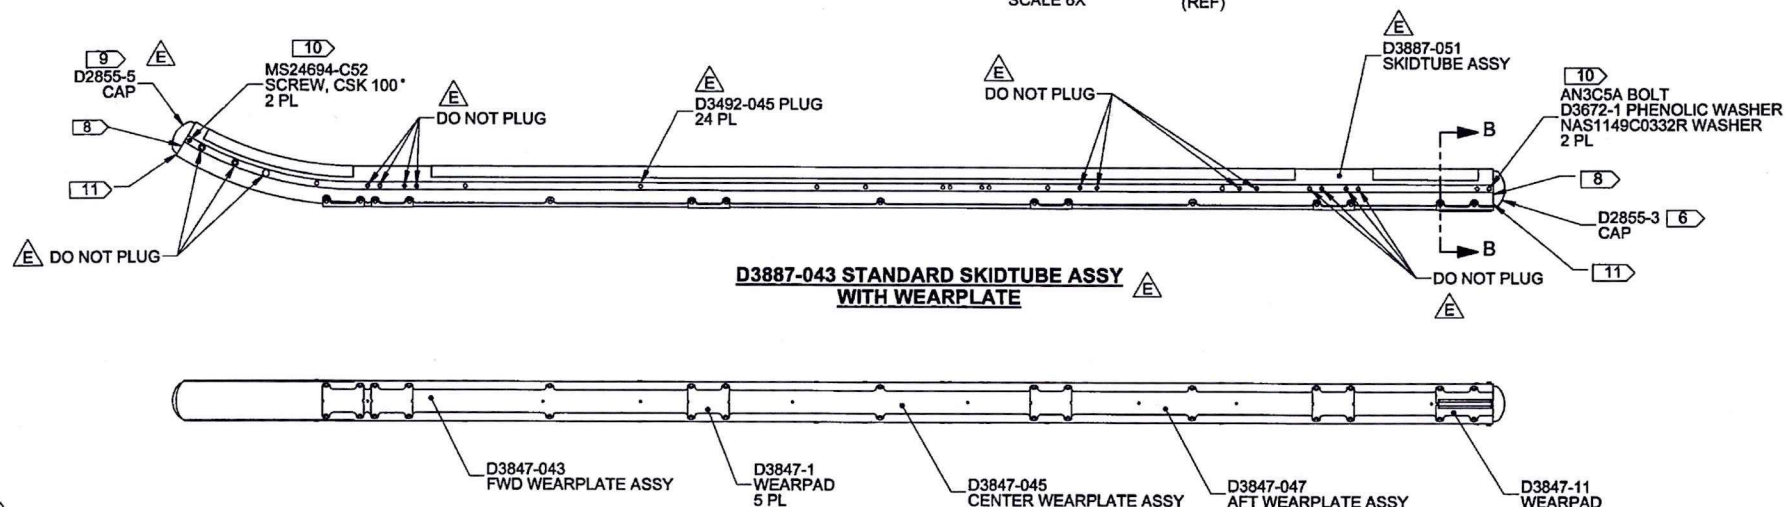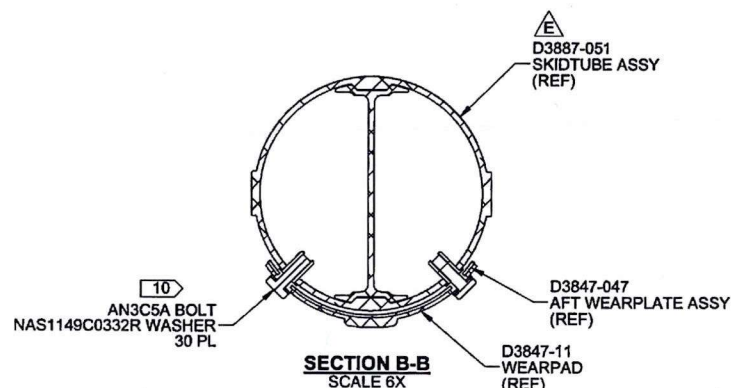

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3887-043" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 37.0 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3887-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP. OPEN HOLE TO Ø0.297, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 3 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY NTS	
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

D

NOTES:

- A

APPROVED

A

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -051	P/N	DESCRIPTION
	X	D3887-051	SKIDTUBE ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3881-1	CROSS BOLT SPACER
3	1	D3885-1	STANDARD WEB
4	1	D3887-11	SKIDTUBE
5	12	D3903-1	CROSS BOLT SPACER
6	30	ALS4-1032-130	INSERT

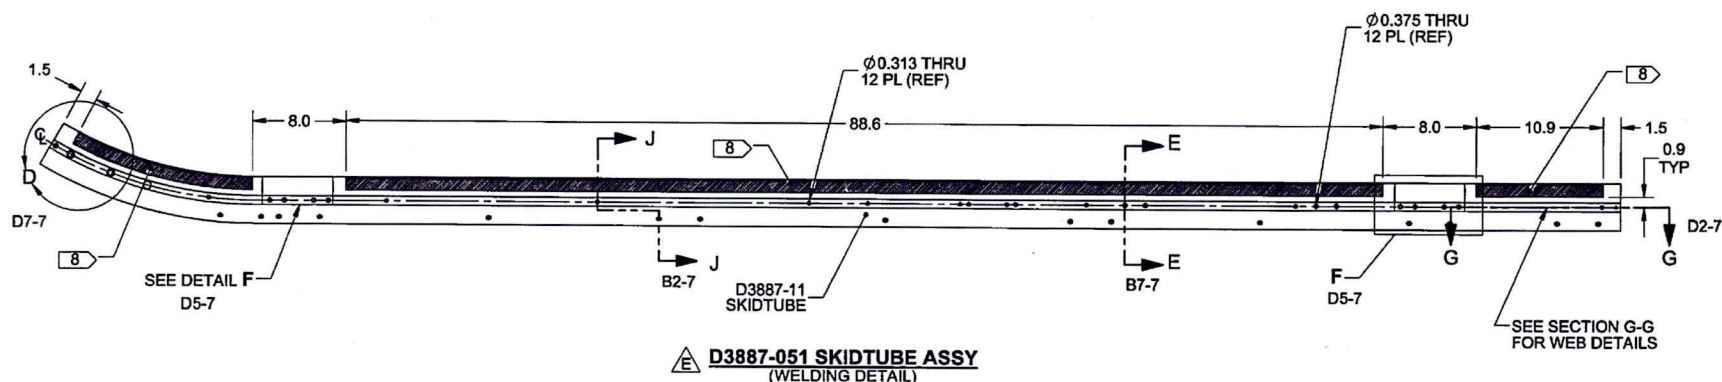

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50 ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 5 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY -053	P/N	DESCRIPTION
	X	D3887-053	SKIDTUBE ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	CROSS BOLT SPACER
3	1	D3885-1	STANDARD WEB
4	1	D3887-13	SKIDTUBE
5	12	D3903-1	CROSS BOLT SPACER

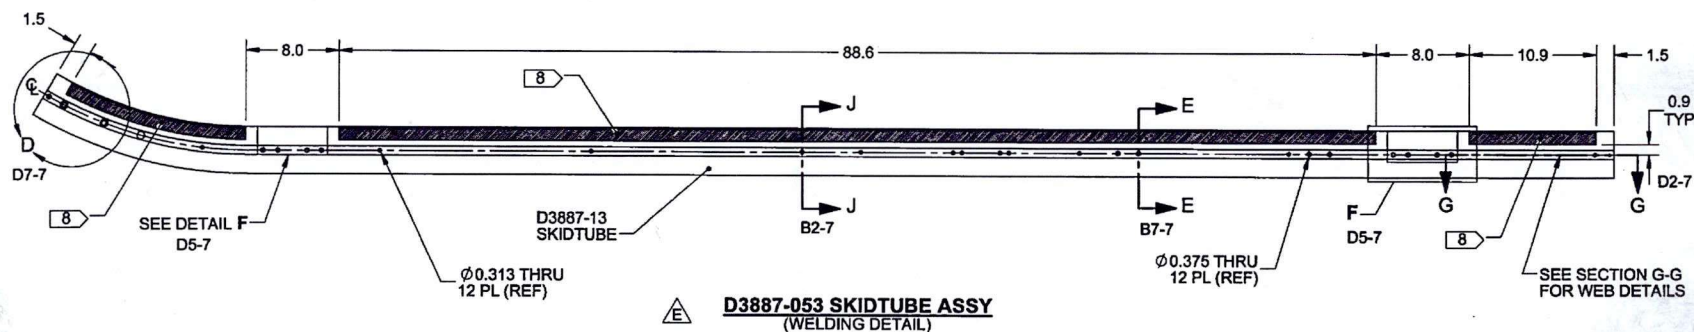

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50 ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 6 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

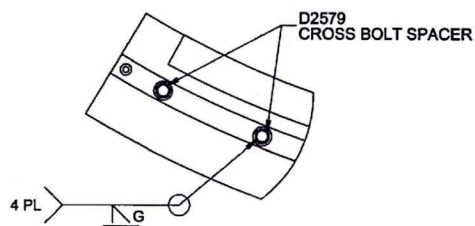


DETAIL D
SCALE 2X
TYP

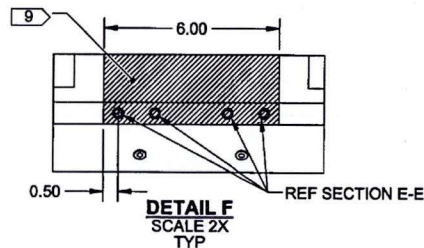

DETAIL F
SCALE 2X
TYP

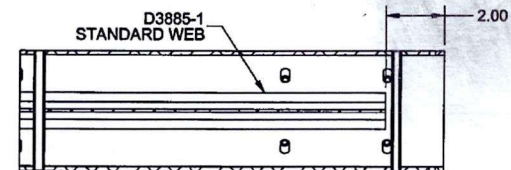


SECTION G-G
SCALE 2X
TYP

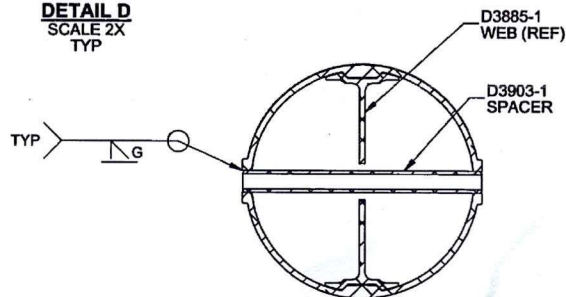

SECTION E-E
SCALE 5X
TYP

(FOR 12X $\phi 0.375$ HOLES
PER SKIDTUBE)

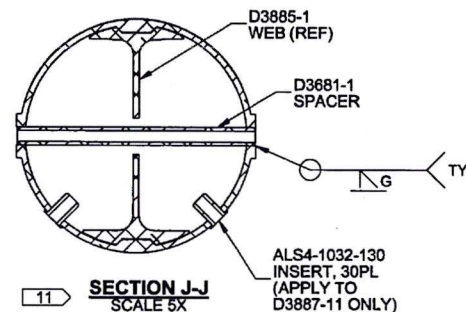

SECTION J-J
SCALE 5X
TYP

(FOR 12X $\phi 0.313$ HOLES
PER SKIDTUBE)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING. ENSURE HOLES LINE-UP
- 9) MASK THIS AREA AND DO NOT POWDER COAT
- 10) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION E-E $\phi 0.375$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.475 \times 45^\circ$
 - ii) INSERT D3903-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) C'BORE TO $\phi 0.313 \times 0.75$ DEEP
 - v) DEBURR HOLES
- 11) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION J-J $\phi 0.313$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.354 \times 45^\circ$ OR 0.050 DEEP $\times 45^\circ$ (BOTH SIDES)
 - ii) INSERT D3681-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) DEBURR HOLES
- 12) WELD PER DART QSI 004

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 7 of 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

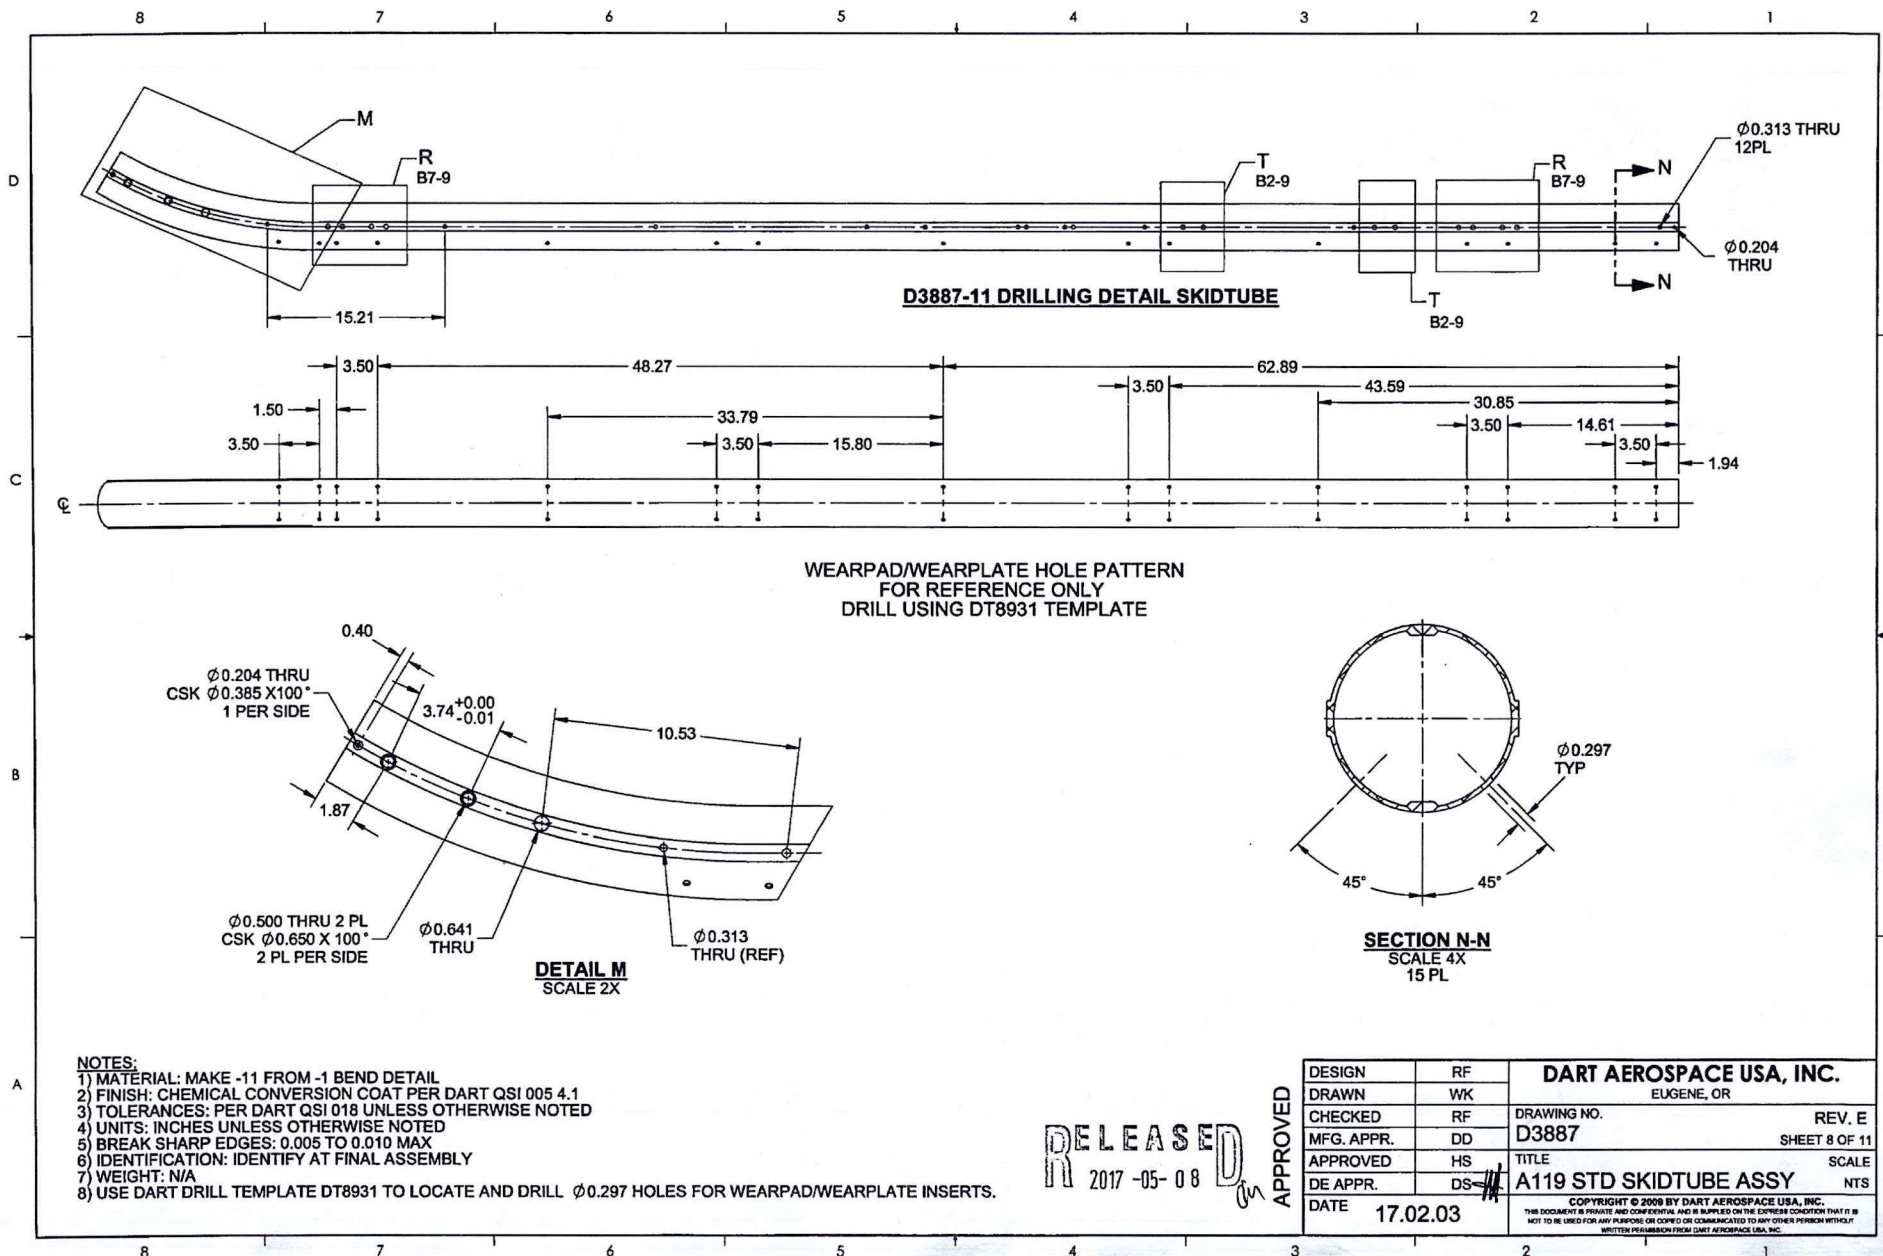

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

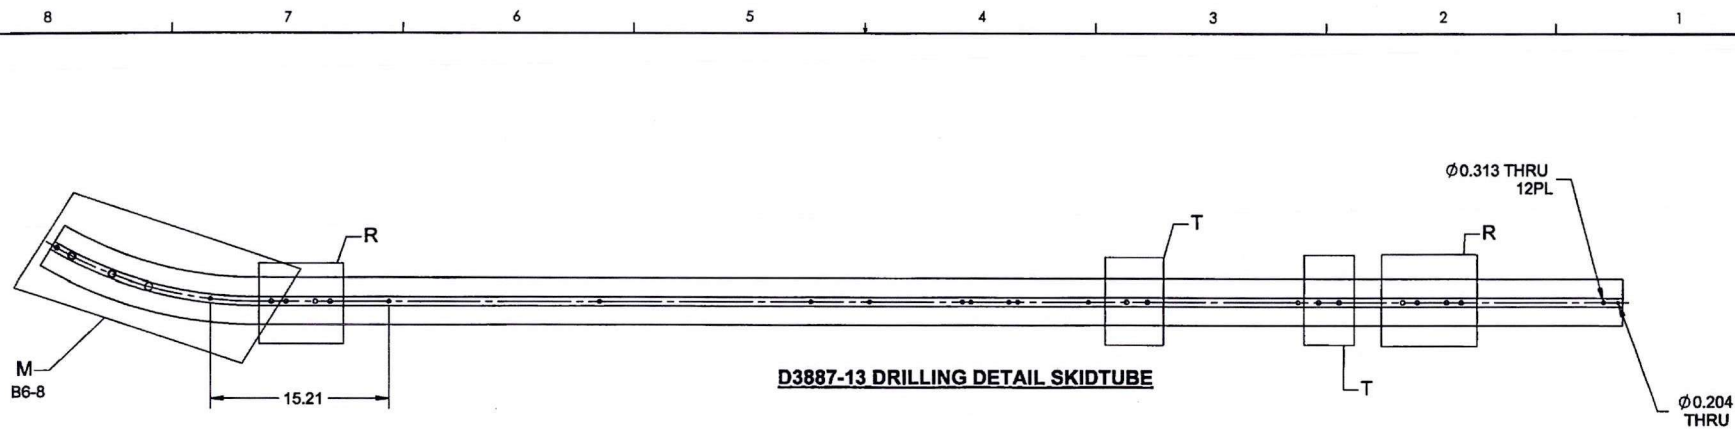

D3887-13 DRILLING DETAIL SKIDTUBE

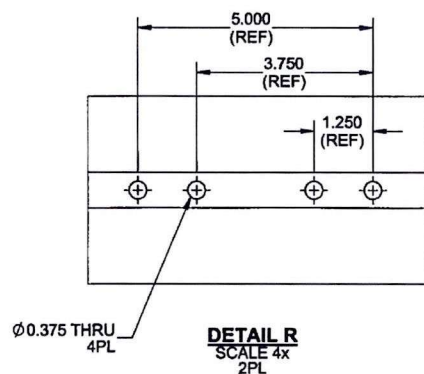

DETAIL R
SCALE 4x
2PL

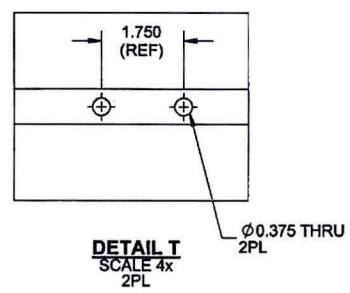

DETAIL T
SCALE 4x
2PL

NOTES:

- 1) MATERIAL: MAKE -13 FROM -1 BEND DETAIL
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 9 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐		
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)
Description Work Order Deviation		Disposition		Completed By
				Lead hand / Supervisor
				QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		
Other/Details:				

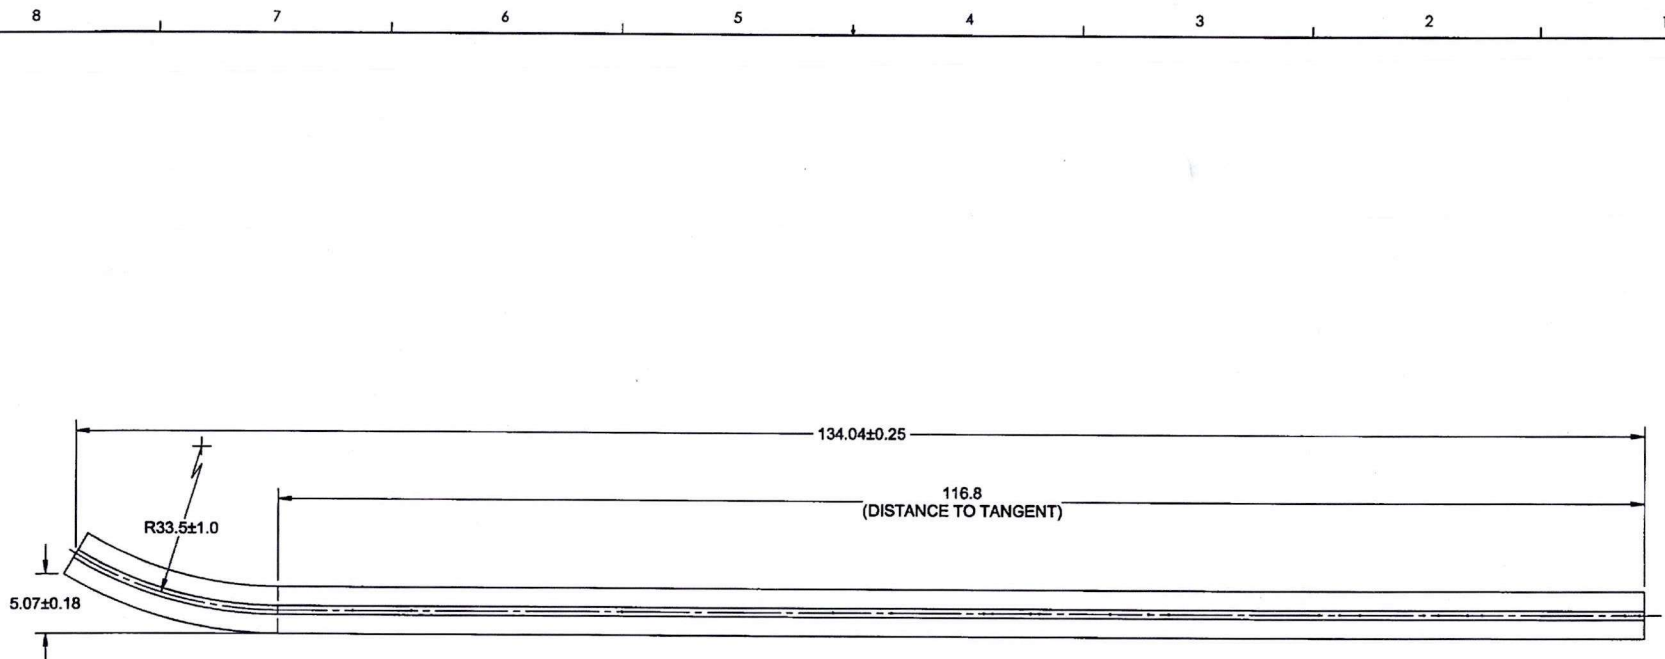

D3887-1 BEND DETAIL SKIDTUBE

NOTES:

- 1) MATERIAL: MAKE -1 BEND DETAIL FROM -3 PILOT HOLE DETAIL
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 10 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

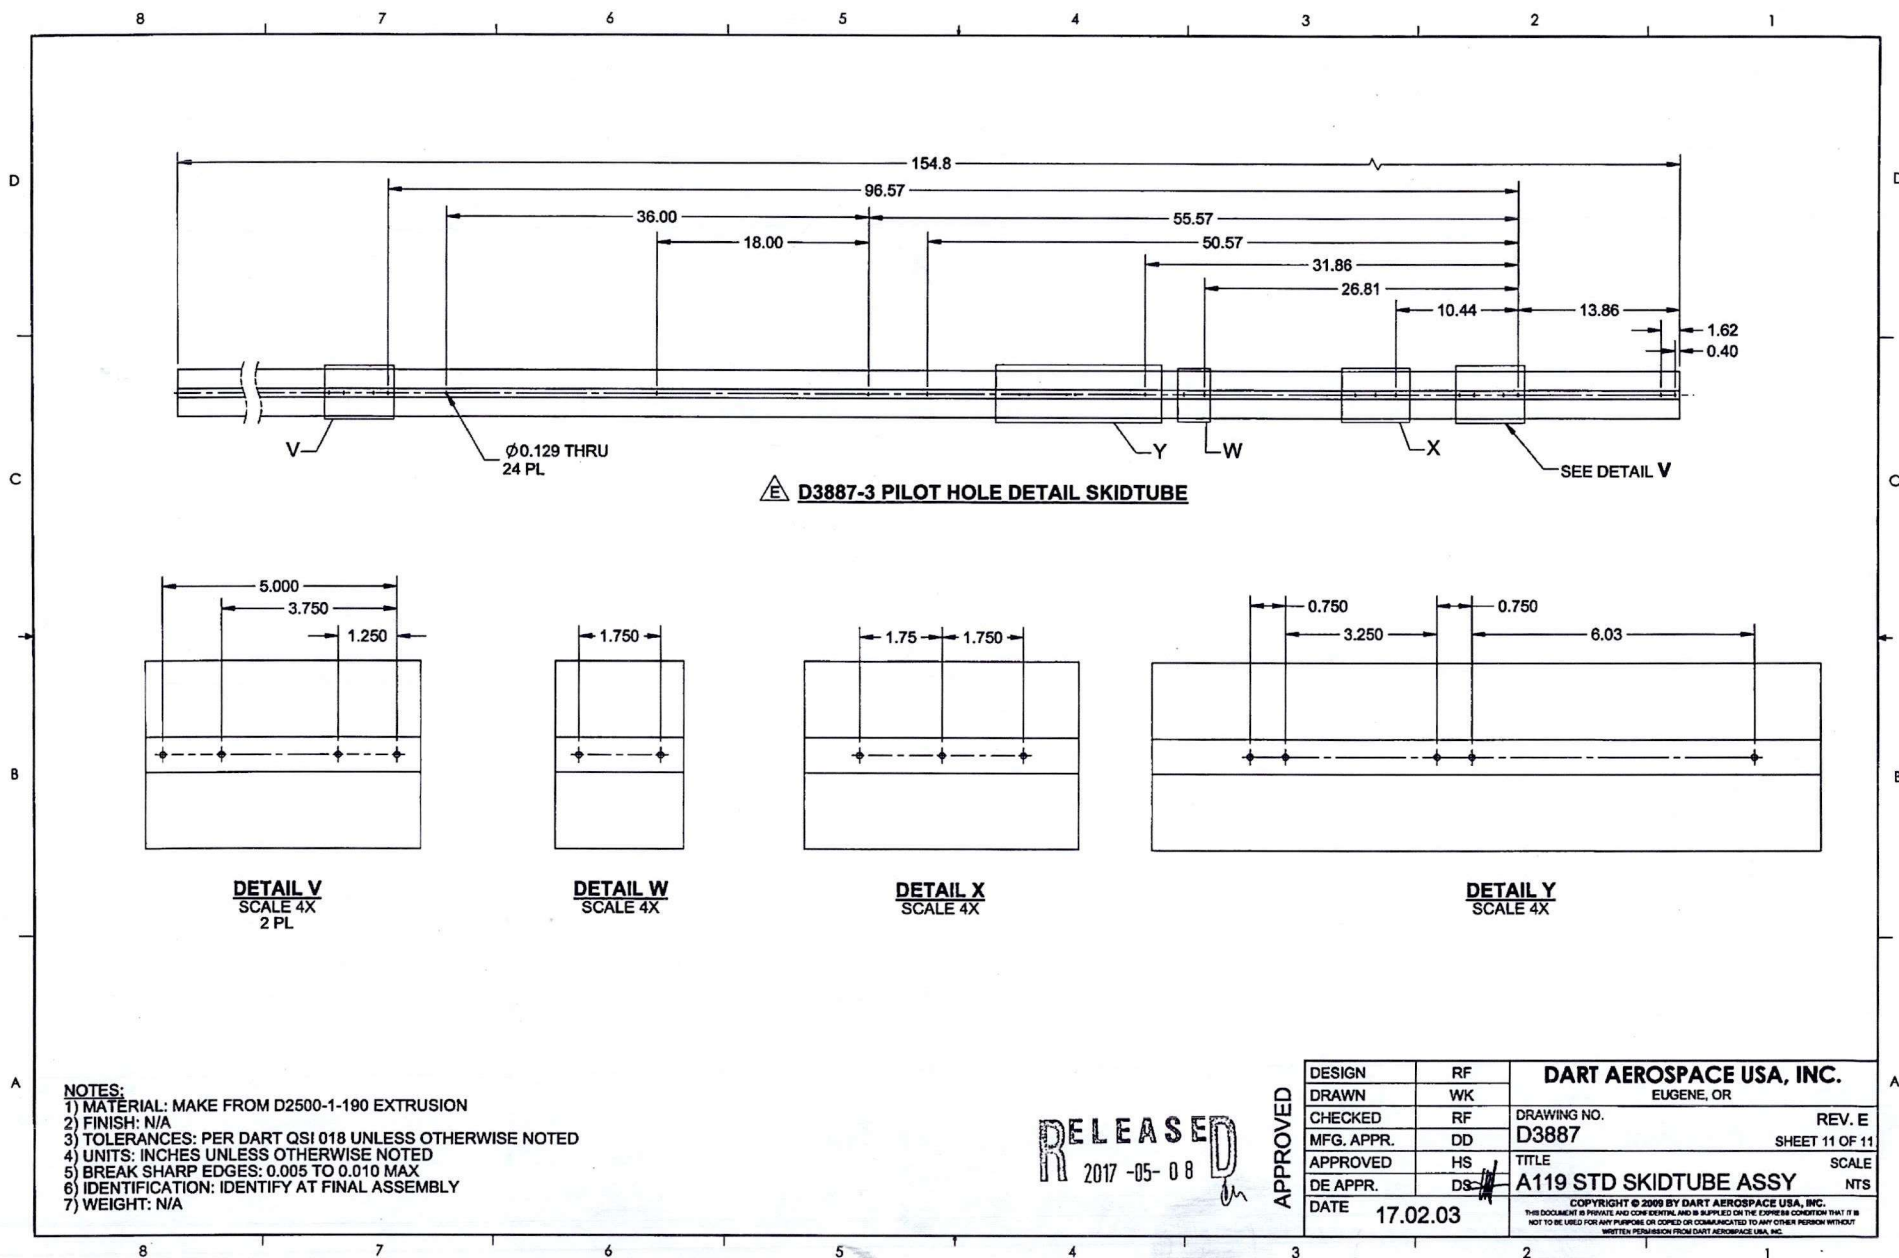

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By _____	
				Lead hand / Supervisor _____	
				QC / QA Coordinator _____	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____ _____ _____					